

## SUMMARY OF RESULTS FIBI048 - Buckhorn Creek



1. Stream Name:	Buckhorn Creek
2. Sampling Date:	07-09-2002
3. Sampling Location:	off Reeder Road (40 46 21.66; -75 07 09.29)
4. Municipality:	Harmony Twp.
5. County:	Warren
6. Watershed Management Area:	1
7. Contributing Drainage Area:	8 Square Miles
8. Electrofishing Gear:	Backpack
9. FIBI Score and Rating:	40 - Good
10. Habitat Score and Rating:	166 - Optimal
11. Fishable Species Present:	Yes
12. Relevant AMNET <sup>1</sup> Station Data	
Proximity of FIBI station to AMNET station:	0.66 mi upstream AN0050
AMNET Rating:	Round 1 – NONE; Round 2 – NONE
13. Stream Chemistries	
Dissolved Oxygen:	8.2 mg/L
Temperature:	21.5 °C
pH:	7.17
Conductivity:	210 μmhos/cm
14. Number of Fish with Anomalies:	1
15. Length of Stream Segment Sampled:	150 Meters
16. Water Clarity:	Clear
17. Average Open Forest Canopy:	23.4%
18. Discharge:	5.24 ft. <sup>3</sup> /sec
19. Substrate:	10% Gravel and Sand, 80% Cobble, 5% Boulder, 0% Clay, 5% Silt
20. Habitat:	60% Riffle, 10% Run, 30% Pool
21. Snags:	Yes
22. Periphyton:	Slight
23. Submerged Aquatic Vegetation:	No
24. Other Observations:	Filamentous algae, Dead rainbow trout
25. Number of Fish Species Identified:	10
26. Total Number of Fish Collected:	763

<sup>1</sup> AMNET is the acronym for the DEP's ambient benthic macroinvertebrate monitoring network – a series of 820 monitoring stations located throughout the state's waterways that collects data on the health of bottom dwelling stream fauna which in turn is used to assess general water quality.

# FIBI048 BUCKHORN CREEK Reeder Road Harmony Township, Warren County

Reeder Rd.

0.1 Miles

0



Belvidere Rd.

R

Direction of Flow

FIBI048 - Buckhorn Creek off Reeder Road Date Sampled - 7/09/2002	d Exe	cellent	Good	Fair	Poor
# of Fish Species				Score 5	
# of Benthic Insectivorous Species (BI)				5	
# of Trout and Centrarchid Species (trout, ba	ss, sunfish, crap	pie)		1	
# of Intolerant Species (IS)				3	
Proportion of Individuals as White Suckers				5	
Proportion of Individuals as Generalists (carp, goldfish, fathead minnow, green sunfish)	creek chub, banded	l killifish,		5	
Proportion of Individuals as Insectivorous <b>Cy</b>	<b>prinids</b> (I and Bl	I)		5	
Proportion of Individuals as Trout OR	*whichever give	es better	score		
Proportion of Individuals as Pisciviores (Exclu	uding American I	Eel)*		1	
Number of Individuals in Sample				5	
Proportion of Individuals w/disease/anomalie	s (excluding blac	ckspot)		5	
Total				40	
Stream Rating					
45-50 Excellent					

37-44

29-36

10-28

Good

Fair

Poor

#### HABITAT ASSESSMENT FOR HIGH GRADIENT STREAMS

Buckhorn Creek (FIBI048) – 7/9/02

	Condition Category				
	Optimal	Suboptimal	Marginal	Poor	
1. Epifaunal Substrate /Available Cover	Greater than 70% of substrate favorable for epifaunal colonization and fish cover; mix of snags, submerged logs, undercut banks, cobble or other stable habitat and at stage to allow full colonization potential (i.e., logs/snags that are <u>not</u> new fall and <u>not</u> transient).	40-70% mix of stable habitat; well-suited for full colonization potential; adequate habitat for maintenance of populations; presence of additional substrate in the form of newfall, but not yet prepared for colonization (may rate at high end of scale).	20-40% mix of stable habitat; habitat availability less than desirable; substrate frequently disturbed or removed.	Less than 20% stable habitat; lack of habitat is obvious; substrate unstable or lacking.	
SCORE 18	20 19 <b>18</b> 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0	
2. Embeddedness	Gravel, cobble, and boulder particles are 0-25% surrounded by fine sediment. Layering of cobble provides diversity of niche space	Gravel, cobble, and boulder particles are 25-50% surrounded by fine sediment.	Gravel, cobble, and boulder particles are 50-75% surrounded by fine sediment.	Gravel, cobble, and boulder particles are more than 75% surrounded by fine sediment.	
SCORE 18	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0	
3. Velocity/Depth Regimes	All 4 velocity/depth regimes present (slow-deep, slow-shallow, fast-deep, fast-shallow). (slow is <0.3 m/s, deep is >0.5 m)	Only 3 of the 4 regimes present (if fast-shallow is missing, score lower than if missing other regimes).	Only 2 of the 4 habitat regimes present (if fast-shallow or slow- shallow are missing, score low).	Dominated by 1 velocity / depth regime (usually slow-deep).	
SCORE 13	20 19 18 17 16	15 14 <b>13</b> 12 11	10 9 8 7 6	5 4 3 2 1 0	
4. Sediment Deposition	Little or no enlargement of islands or point bars and less than 5% (<20% for low-gradient streams) of the bottom affected by sediment deposition.	Some new increase in bar formation, mostly from gravel, sand or fine sediment; 5-30% (20-50% for low-gradient) of the bottom affected; slight deposition in pools.	Moderate deposition of new gravel, sand or fine sediment on old and new bars; 30-50% (50- 80% for low-gradient) of the bottom affected; sediment deposits at obstructions, constrictions, and bends; moderate deposition of pools prevalent.	Heavy deposits of fine material, increased bar development; more than 50% (80% for low-gradient) of the bottom changing frequently; pools almost absent due to substantial sediment deposition.	
SCORE 18	20 <b>19 18</b> 17 16	15 14 13 <b>12</b> 11	10 9 8 7 6	5 4 3 2 1 0	
5. Channel Flow Status	Water reaches base of both lower banks, and minimal amount of channel substrate is exposed.	Water fills >75% of the available channel; or <25% of channel substrate is exposed.	Water fills 25-75% of the available channel, and/or riffle substrates are mostly exposed.	Very little water in channel and mostly present as standing pools.	
SCORE 16	20 19 18 17 <b>16</b>	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0	
6. Channel Alteration	Channelization or dredging absent or minimal; stream with normal pattern.	Some channelization present, usually in areas of bridge abutments; evidence of past channelization, i.e., dredging, (greater than past 20 yr) may be present, but recent channelization is not present.	Channelization may be extensive; embankments or shoring structures present on both banks; and 40 to 80% of stream reach channelized and disrupted.	Banks shored with gabion or cement; over 80% of the stream reach channelized and disrupted. In stream habitat greatly altered or removed entirely.	
SCORE 18	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0	
7. Frequency of Riffles (or bends)	Occurrence of riffles relatively frequent; ratio of distance between riffles divided by width of the stream <7:1 (generally 5 to 7); variety of habitat is key. In streams where riffles are continuous, placement of boulders or other large, natural obstruction is important.	Occurrence of riffles infrequent; distance between riffles divided by the width of the stream is between 7 to 15.	Occasional riffle or bend; bottom contours provide some habitat; distance between riffles divided by the width of the stream is between 15 to 25.	Generally all flat water or shallow riffles; poor habitat; distance between riffles divided by the width of the stream is a ratio of >25.	
SCORE 16	20 19 18 17 <b>16</b>	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0	
8. Bank Stability (score each bank) Note: determine left or right side by facing downstream.	Banks stable; evidence of erosion or bank failure absent or minimal; little potential for future problems. <5% of bank affected.	Moderately stable; infrequent, small areas of erosion mostly healed over. 5-30% of bank in reach has areas of erosion.	Moderately unstable; 30-60% of bank in reach has areas of erosion; high erosion potential during floods.	Unstable; many eroded areas; "raw" areas frequent along straight sections and bends; obvious bank sloughing; 60- 100% of bank has erosional scars.	
SCORE9 (LB)					
	Left 10 9 Right 10 9	8 7 6 8 7 6	5 4 3 5 4 3	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	
SCORE 9 (RB) 9. Bank Vegetative Protection (score each bank)	Left         10         9           Right         10         9           More than 90% of the streambank surfaces and immediate riparian zone covered by native vegetation, including trees, under story shrubs, or nonwoody macrophytes; vegetative disruption through grazing or mowing minimal or not evident; almost all plants allowed to grow naturally.	8     7     6       8     7     6       70-90% of the streambank surfaces covered by native vegetation, but one class of plants is not well-represented; disruption evident but not affecting full plant growth potential to any great extent; more than one-half of the potential plant stubble height remaining.	5     4     3       5     4     3       50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation common; less than one-half of the potential plant stubble height remaining.	2     1     0       2     1     0   Less than 50% of the streambank surfaces covered by vegetation; disruption of streambank vegetation is very high; vegetation has been removed to 5 centimeters or less in average stubble height.	
SCORE9_ (RB) 9. Bank Vegetative Protection (score each bank) SCORE9_ (LB)	Right         10         9           More than 90% of the streambank surfaces and immediate riparian zone covered by native vegetation, including trees, under story shrubs, or nonwoody macrophytes; vegetative disruption through grazing or mowing minimal or not evident; almost all plants allowed to grow naturally.           Left         10         9	8     7     6       70-90% of the streambank surfaces covered by native vegetation, but one class of plants is not well-represented, disruption evident but not affecting full plant growth potential to any great extent; more than one-half of the potential plant stubble height remaining.       8     7     6	5     4     3       50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation common; less than one-half of the potential plant stubble height remaining.       5     4     3	2     1     0       Less than 50% of the streambank surfaces covered by vegetation; disruption of streambank vegetation is very high; vegetation has been removed to 5 centimeters or less in average stubble height.       2     1     0	
SCORE9_ (RB) 9. Bank Vegetative Protection (score each bank) SCORE9_ (LB) SCORE7_ (RB) 10. Riparian Vegetative Zone Width (score each bank riparian	Right         10         9           More than 90% of the streambank surfaces and immediate riparian zone covered by native vegetation, including trees, under story shrubs, or nonwoody macrophytes; vegetative disruption through grazing or mowing minimal or not evident; almost all plants allowed to grow naturally.           Left         10         9           Right         10         9           Width of riparian zone >18 meters; human activities (i.e., parking lots, roadbeds, clear-cuts, lawns, or crops) have not         10	8 7 6 70-90% of the streambank surfaces covered by native vegetation, but one class of plants is not well-represented; disruption evident but not affecting full plant growth potential to any great extent; more than one-half of the potential plant stubble height remaining.	5 4 3 50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation common; less than one-half of the potential plant stubble height remaining.	2 1 0 Less than 50% of the streambank surfaces covered by vegetation; disruption of streambank vegetation is very high; vegetation has been removed to 5 centimeters or less in average stubble height.	
SCORE9_ (RB) 9. Bank Vegetative Protection (score each bank) SCORE9_ (LB) SCORE7_ (RB) 10. Riparian Vegetative Zone Width (score	Right         10         9           More than 90% of the streambank surfaces and immediate riparian zone covered by native vegetation, including trees, under story shrubs, or nonwoody macrophytes; vegetative disruption through grazing or mowing minimal or not evident; almost all plants allowed to grow naturally.           Left         10         9           Right         10         9           Width of riparian zone >18 meters; human activities (i.e., parking lots, roadbeds, clear-cuts,         10	8     7     6       70-90% of the streambank surfaces covered by native vegetation, but one class of plants is not well-represented; disruption evident but not affecting full plant growth potential to any great extent; more than one-half of the potential plant stubble height remaining.       8     7     6       8     7     6       8     7     6       8     7     6       8     7     6       8     7     6       8     7     6       8     7     6       8     7     6       8     7     6	5     4     3       50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation common; less than one-half of the potential plant stubble height remaining.       5     4     3       5     4     3       Width of riparian zone 6-12 meters; human activities have	2       1       0         Less than 50% of the streambank surfaces covered by vegetation; disruption of streambank vegetation is very high; vegetation has been removed to 5 centimeters or less in average stubble height.       1       0         2       1       0       2       1       0         2       1       0       2       1       0         2       1       0       2       1       0         Width of riparian zone <6 meters: little or no riparian vegetation due	

habitat score 166

HABITAT SCORES	VALUE	
OPTIMAL	160 - 200	
SUB-OPTIMAL	110 - 159	
MARGINAL	60 - 109	
POOR	< 60	

FIBI048 07-09-2002


Buckhorn Creek

#### LISTED IN ORDER OF ABUNDANCE FOUND

COMMON NAME	SCIENTIFIC NAME	# FOUND	SIZE RANGE (INCHES)
Blacknose Dace	Rhinichthys atratulus	459	
Creek Chub	Semotilus atromaculatus	80	
Tesselated Darter	Etheostoma olmstedi	73	
White Sucker*	Catostomus commersoni	55	
Longnose Dace	Rhinichthys cataractae	40	
American Eel*	Anguilla rostrata	23	
Margined Madtom	Noturus insignis	20	
Sea Lamprey	Petromyzon marinus	11	
Bluegill*	Lepomis macrochirus	1	2.4
Common Shiner	Luxilus cornutus	1	

\* Regulated as a fishable species under current New Jersey Fish and Wildlife codes


### Species Identified at Buckhorn Creek (FIBI048) (Not to Scale)

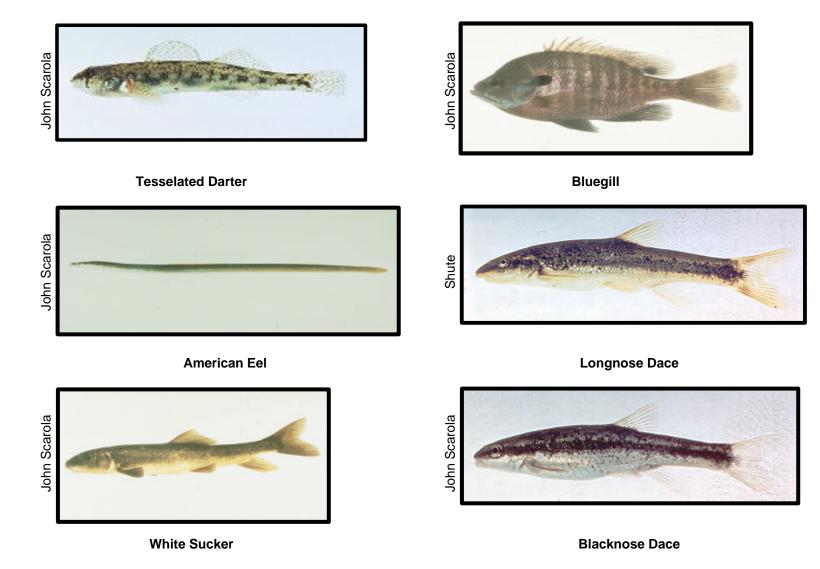

### Species Identified at Buckhorn Creek (FIBI048) (Not to Scale)



**Common Shiner** 

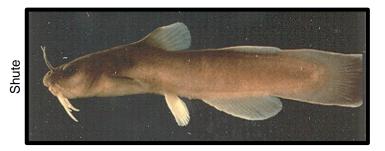

**Margined Madtom** 







Sea Lamprey